


7/16-3200B-L400

7/16 Plug Clamp

50Ω

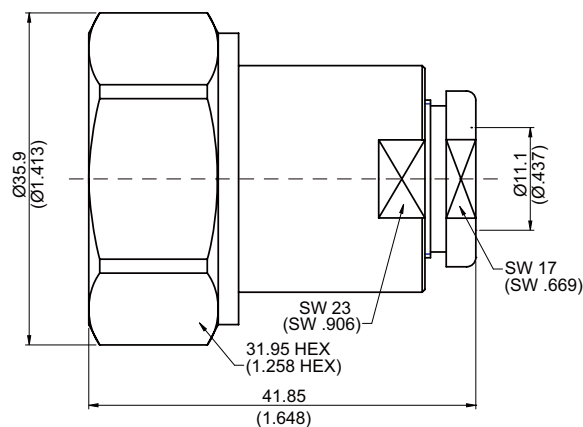

Parts	Material	Plating(Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Silver 150 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 125.56 g
Suitable Cables: JBY400

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

7/16-3200B-L400

JYE BAO CO., LTD.
TAIPEI TAIWAN R.O.C

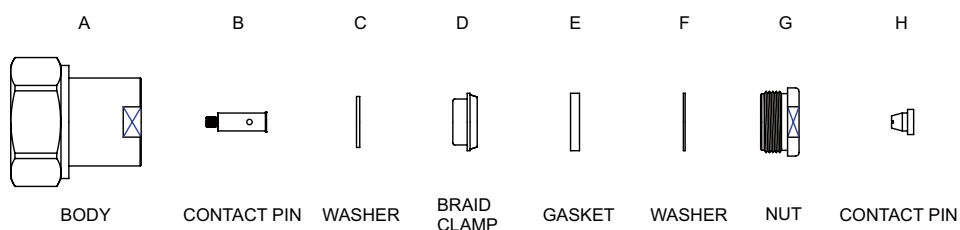


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN .
	Step 2: SLIDE BRAID CLAMP " D ", GASKET " E ", WASHER " F " AND NUT " G " OVER CABLE .
	Step 3: WRAP THE BRAIDING OVER " D ".
	Step 4: STRIP AS SHOWN.
	Step 5: SLIDE PREPARED CABLE INTO WASHER " C ". Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".
	Step 7: SCREW " G " ON THE CONNECTOR BODY " A ". Step 8: FINALLY SCREW CONTACT PIN " H " ON CONTACT PIN " B ".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.