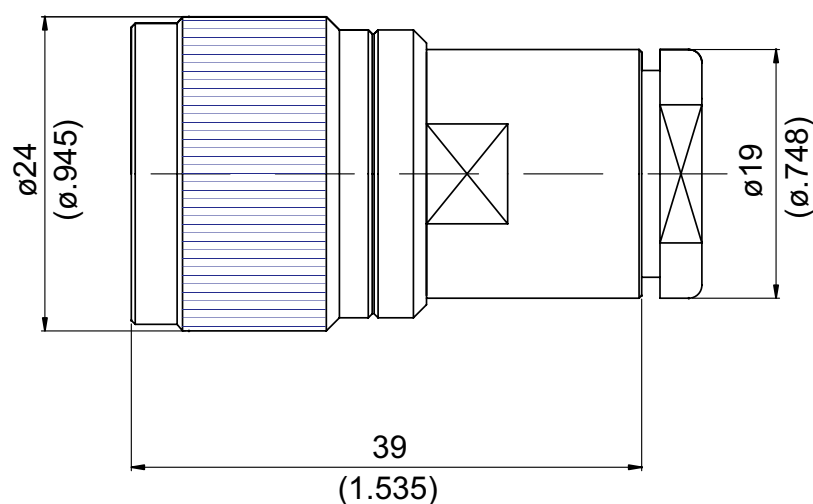


HN3200-0213/HDPE

**HN Plug Clamp for RG213
(Radiation Resistant)**

50Ω



Note: Radiation Resistant

Parts	Material	Plating(Micro-inch)
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Top Hat	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Silver 150 Over Copper 50
Insulator	HDPE	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

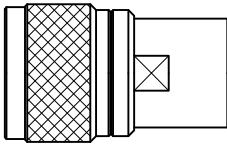

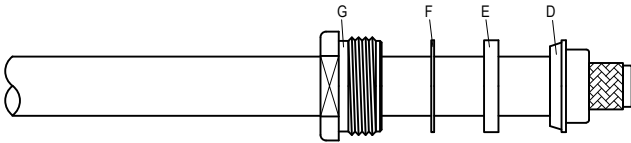
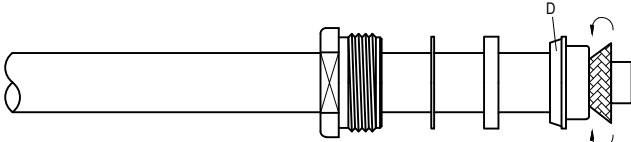
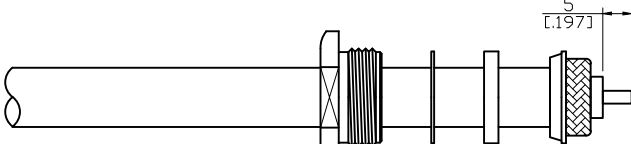
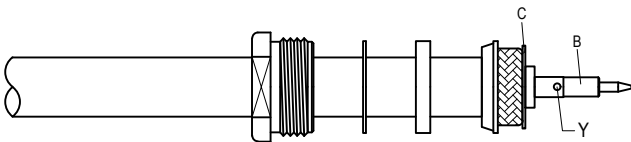
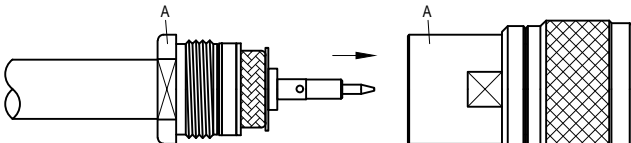
Suitable Cables: RG8,RG213

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

HN3200-0213/HDPE			DATE	2017/03/27	REV	—
A	B	C	D	E	F	G
						
BODY	CONTACT PIN	WASHER	BRAID CLAMP	GASKET	WASHER	NUT
DIAGRAM			ASSEMBLY INSTRUCTION			
			Step 1: STRIP AS SHOWN.			
			Step 2: SLIDE " G " 、 WASHER " F " 、 GASKET " E " AND BRAID CLAMP " D " OVER CABLE.			
			Step 3: WRAP THE BRAIDING OVER BRAID CLAMP " D " .			
			Step 4: STRIP AS SHOWN.			
			Step 5: SLIDE PREPARED CABLE INTO WASHER " C " . Step 6: PUT CONTACT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y " .			
			Step 7: FINALLY SCREW NUT " F " ON THE CONNECTOR BODY " A " .			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.						
APPROVED		CHECKED		DRAWING		
				Albert		