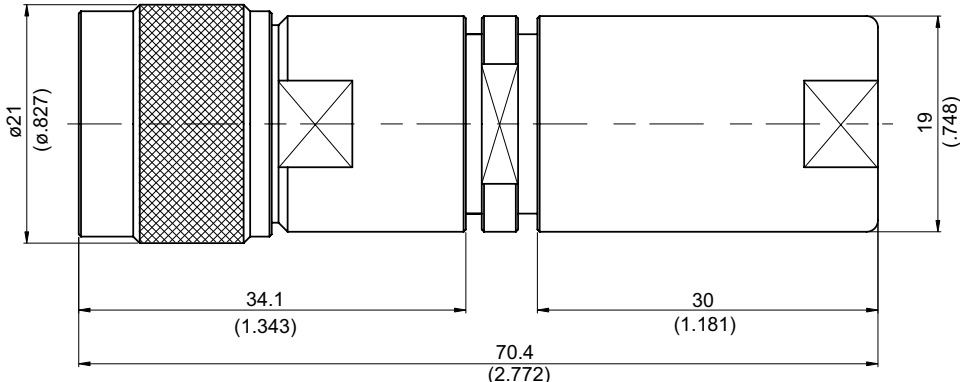


N3200B-0215	N Plug Clamp	50Ω																																	
																																			
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Braid Clamp</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Washer</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Center Pin</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr><tr><td>Retainer Ring</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50	Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																																	
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Braid Clamp	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Washer	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Insulator	Teflon																																		
Center Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50																																	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Gasket	Silicon																																		
Contact Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																																	
Weight: 90.54 g																																			
Suitable Cables: RG215																																			

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3200B-0215

JYE BAO CO., LTD.

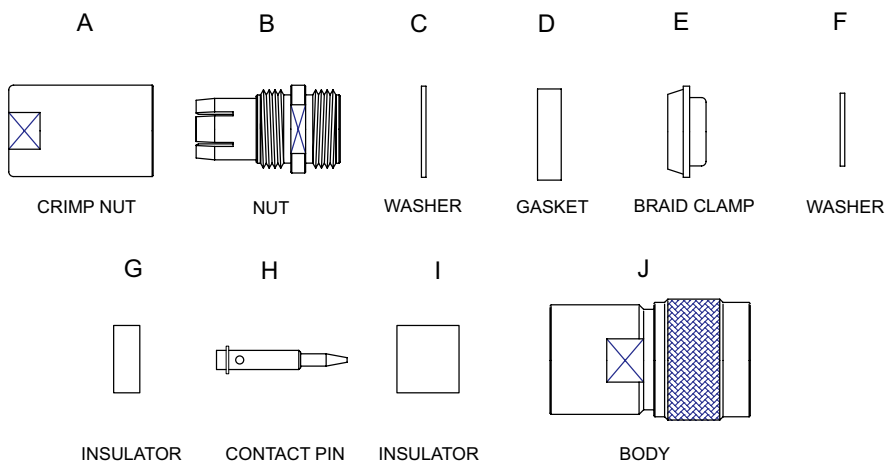


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE "A" "B" "C" "D" "E" OVER CABLE.
	Step 3: WRAP THE BRAIDING OVER "E". Step 4: STRIP THE DIELECTRIC AS SHOWN.
	Step 5: SLIDE "F" "G" IN PLACE. Step 6: PUT PIN "H" AND IN PLACE AND SOLDER IT TO THE CENTER CONDUCTOR.
	Step 7: SLIDE TEFLON "I" INTO CONNECTOR BODY "J". Step 8: SCREW "B" ON THE CONNECTOR BODY "J". Step 9: SCREW "A" ON THE CONNECTOR BODY "B".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.