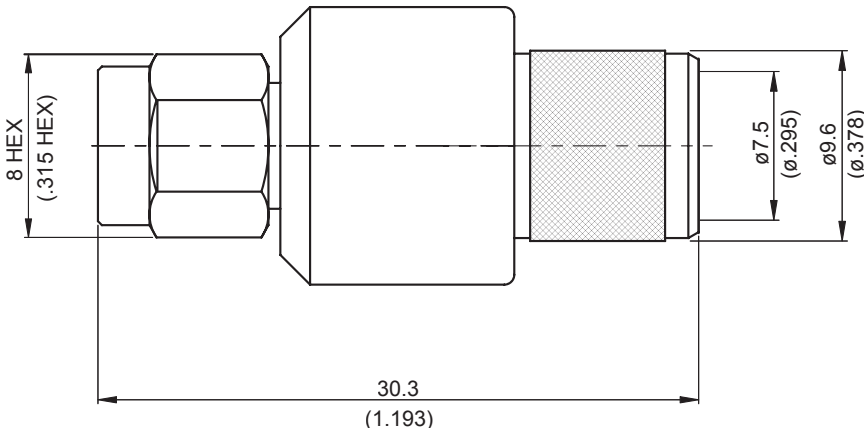


SMA3100-L400	SMA Plug Crimp	50Ω																											
																													
<table><tr><th>Parts</th><th>Material</th><th>Plating(Micro-inch)</th></tr><tr><td>Ferrule</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 20 Over Nickel 50 Over Copper 50</td></tr><tr><td>Renbrock Ring</td><td>Beryllium Copper</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Barrel</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr></table>			Parts	Material	Plating(Micro-inch)	Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50	Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating(Micro-inch)																											
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50																											
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Gasket	Silicon																												
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Insulator	Teflon																												
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Weight: 34.22 g Suitable Cables: LMR400, JBY400																													

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA3100-L400

JYE BAO CO., LTD.
TAIPEI TAIWAN R.O.C

B




FERRULE

E




CONTACT PIN

A



BODY


DIAGRAM

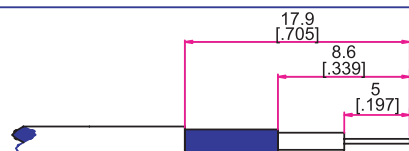

ASSEMBLY INSTRUCTION

Step 1: STRIP

B




E



Step 2: SLIDE FERRULE 'B' OVER CABLE.


Step 3: PUT PIN 'E' ON CENTER CONDUCTOR AND SOLDER IN "Y".

A



Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR 'A' IN PLACE.

B



Step 5: SLIDE FERRULE 'B' TOWARDS THE CONNECTOR 'A' AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.