


SMA3100-9L240

SMA Plug Crimp Right Angle

50Ω

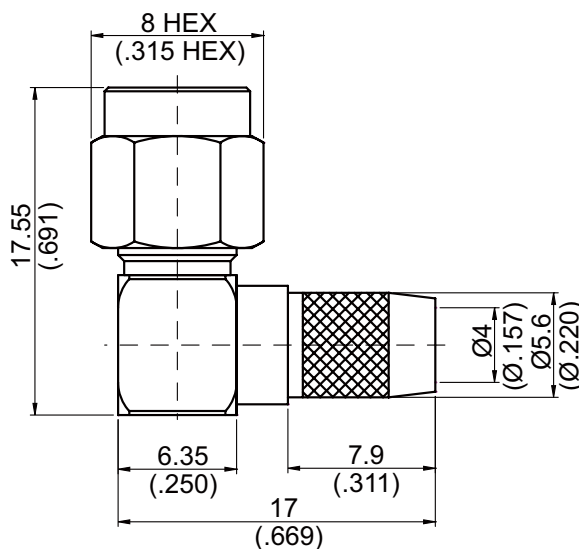

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Cover	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Insulator	Teflon	
Barrel	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Body	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Coupling Nut	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20

Weight:

Suitable Cables: JBY240

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

## CABLE ASSEMBLY INSTRUCTION

SMA3100-9L240

JYE BAO CO., LTD.  
TAIPEI TAIWAN R.O.C

SMA3100-9L240

DATE

2014/04/29



REV

—

A

B

C

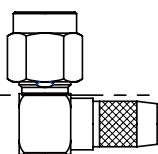

BODY

COVER


FERRULE

DIAGRAM


ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.

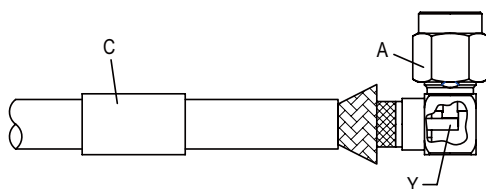

Step 2: SLIDE FERRULE " C " OVER CABLE.  
Step 3: WRAP THE BRAIDING UPWARDS.  
Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".

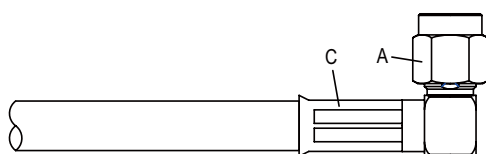

Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP.  
(USE 6.5mm/0.256inch HEX SECTION OF INSERT-E)

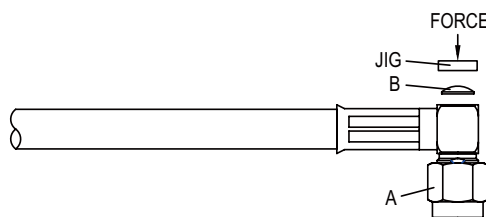

Step 6: PRESS ON THE TOP OF " B " WITH JIGS.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.