


SMA3100-9L300

SMA Plug Crimp Right Angle

50Ω

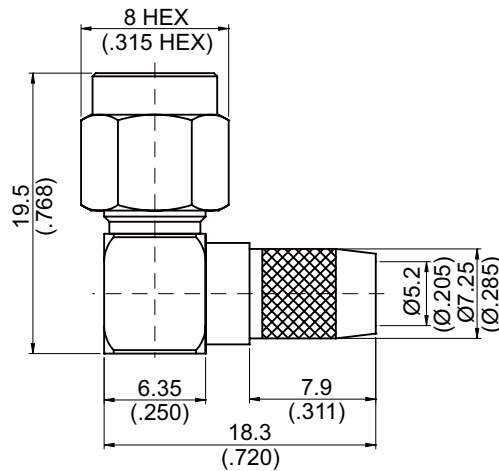

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus 80 Over Copper 20
Insulator	Teflon	
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: JBY300, 5FBB

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA3100-9L300

JYE BAO CO., LTD.
TAIPEI TAIWAN R.O.C

SMA3100-9L300

DATE

2014/04/29



REV

—

A

B

C

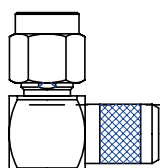

BODY

NUT


FERRULE

DIAGRAM

ASSEMBLY INSTRUCTION




Step 1: STRIP AS SHOWN.

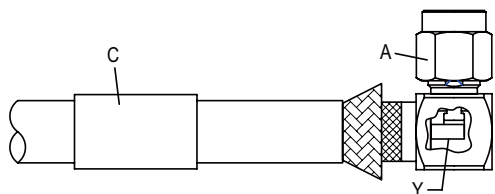

Step 2: SLIDE FERRULE "C" OVER CABLE.
Step 3: WRAP THE BRAIDING UPWARDS.
Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "A" AND SOLDER IN "Y".



Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP.
(USE 7.9mm/0.311inch HEX SECTION OF INSERT-D)

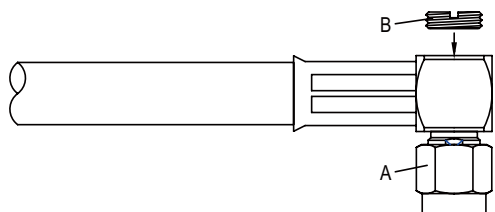

Step 6: FINALLY SCREW NUT "B" ON THE CONNECTOR BODY "A".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.