


SMA6100-0316

SMA Reverse Polarity Plug Crimp 50Ω

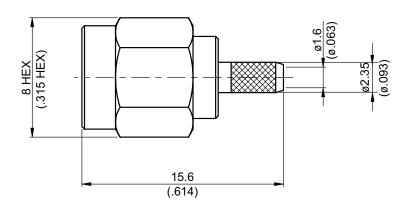

| 1 | | |
|--------------|------------------|--|
| Parts | Material | Plating (Micro-inch) |
| Ferrule | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Contact Pin | Beryllium Copper | Gold 20 Over Nickel 50 Over Copper 50 |
| Renber Ring | Beryllium Copper | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Gasket | Silicon | |
| Insulator | Teflon | |
| Body | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Coupling Nut | Brass | Gold 5 Over Nickel 50 Over Copper 50 |

Weight: 3.01 g

Suitable Cables: RG174, RG188, RG316, RG316-E, RG316-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION SMA6100-0316 JYE BAO CO., LTD. В С Α CONTACT PIN **FERRULE BODY** ASSEMBLY INSTRUCTION **DIAGRAM** Step 1: STRIP AS SHOWN. 2.5 [.098] В Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y". С Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE. Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "C" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.