


SMA 91 SMA Plug Crimp Right Angle 50Ω

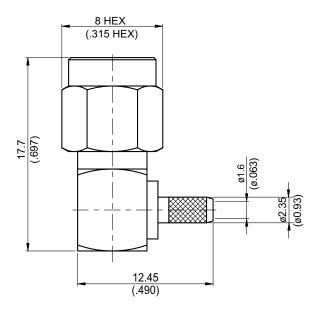

| Parts | Material | Plating (Micro-inch) |
|---------------|------------------|--|
| Ferrule | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Cover | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Renbrock Ring | Beryllium Copper | Tin-Zinc-Copper-Alloy 100 Over Copper 50 |
| Gasket | Silicon | |
| Contact Pin | Brass | Gold 20 Over Nickel 50 Over Copper 50 |
| Insulator | Teflon | |
| Barrel | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Body | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Coupling Nut | Brass | Gold 5 Over Nickel 50 Over Copper 50 |

Weight: 4.8 g

Suitable Cables: RG174, RG188, RG316, RG316-E, RG316-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION SMA3100-9316 JYE BAO CO., LTD. С В Α **FERRULE BODY** COVER DIAGRAM ASSEMBLY INSTRUCTION Step 1: STRIP AS SHOWN. Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "B", AND SOLDER IN "Y". contact pin Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "B" AND CRIMP. Step 6: PRESS ON THE TOP OF "C" WITH JIGS AS SHOWN.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.