


SMA3100-9178

SMA Plug Crimp Right Angle



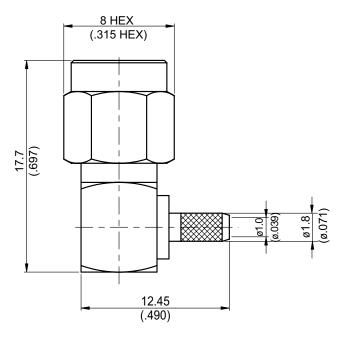

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Cover	Brass	Gold 5 Over Nickel 50 Over Copper 50
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 4.8 g

Suitable Cables: RG178, RG196, RG178-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION SMA3100-9178 JYE BAO CO., LTD. Α В С **FERRULE BODY** COVER DIAGRAM ASSEMBLY INSTRUCTION 10.2 [.401] Step 1: STRIP AS SHOWN. Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "B", AND SOLDER IN "Y". Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "B" AND CRIMP. FORCE Step 6: PRESS ON THE TOP OF "C" WITH JIGS AS SHOWN.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.