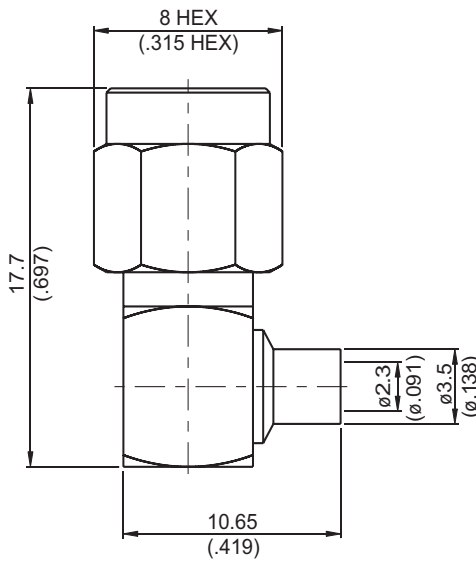


SMA3300-9085	SMA Plug Solder Right Angle 50Ω																												
<div></div>																													
<table><tr><th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr><tr><td>Cover</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr><tr><td>Renbrock Ring</td><td>Beryllium Copper</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr><tr><td>Gasket</td><td>Silicon</td><td></td></tr><tr><td>Contact Pin</td><td>Brass</td><td>Gold 20 Over Nickel 50 Over Copper 50</td></tr><tr><td>Insulator</td><td>Teflon</td><td></td></tr><tr><td>Barrel</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr><tr><td>Body</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr><tr><td>Coupling Nut</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr></table>			Parts	Material	Plating (Micro-inch)	Cover	Brass	Gold 5 Over Nickel 50 Over Copper 50	Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50	Insulator	Teflon		Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50	Body	Brass	Gold 5 Over Nickel 50 Over Copper 50	Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50
Parts	Material	Plating (Micro-inch)																											
Cover	Brass	Gold 5 Over Nickel 50 Over Copper 50																											
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Gasket	Silicon																												
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50																											
Insulator	Teflon																												
Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50																											
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50																											
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50																											
Weight: 4.54 g Suitable Cables: Semi-rigid.085																													

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

## CABLE ASSEMBLY INSTRUCTION

SMA3300-9085

JYE BAO CO., LTD.

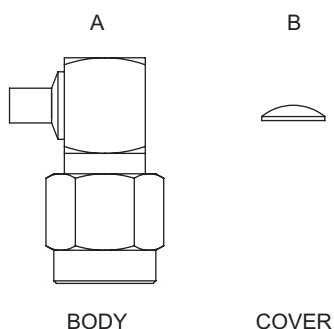


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "A", AND SOLDER IN "Y".
	<p>Step 3: PUT CABLE INTO SOLDERING FIXTURE "ST-008", AND LOCK IT. PUT CONNECTOR AS SHOWN.</p> <p>Step 4: SCREW LOCATOR TOOL "ST-011" TO THE POSITION AS SHOWN IN "S", AND SOLDER IN "X".</p>
	Step 5: PRESS ON THE TOP OF "B" WITH JIGS.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.