


SMA9100-L200

SMA Reverse Polarity Jack Crimp 50Ω

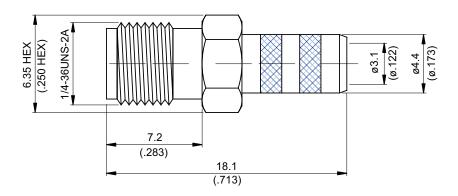

NOTE: REVERSE POLARITY JACK

| Parts | Material | Plating(Micro-inch) |
|-------------|----------|---------------------------------------|
| Ferrule | Brass | Gold 5 Over Nickel 50 Over Copper 50 |
| Contact Pin | Brass | Gold 20 Over Nickel 50 Over Copper 50 |
| Insulator | Teflon | |
| Body | Brass | Gold 5 Over Nickel 50 Over Copper 50 |

Weight:

Suitable Cables: JBY200

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION JYE BAO CO., LTD. SMA9100-L200 **TAIPEI TAIWAN R.O.C** Α В С BODY CONTACT PIN **FERRULE** DIAGRAM ASSEMBLY INSTRUCTION 12.6 [.496] Step 1: STRIP AS SHOWN. 4.7 [.185] 2.8 [.110] С ΥВ Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ". С Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " С Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.