


7/16-3100-0214 7/16 Plug Crimp 50Ω

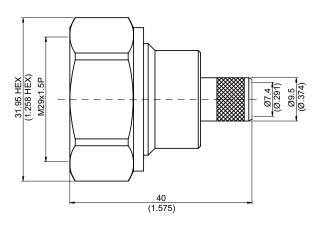

NOTE: Comes with protective cap

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Small Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Contact Pin	Phosphor Bronze	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: RG214

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION 7/16-3100-0214 JYE BAO CO., LTD. В С **BODY CONTACT PIN FERRULE DIAGRAM** ASSEMBLY INSTRUCTION 23.7 [.933] Step 1: STRIP AS SHOWN. 12.4 [.488] Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y" OR CRIMP USE INSERT 3.3 mm/.130 in HEX. Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " $\operatorname{\mathsf{IN}}$ NP LACE. Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR "A " AND CRIMP USE INSERT 10.7 mm/.421 in HEX.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.