


7/16-3100-L400 7/16 Plug Crimp 50Ω

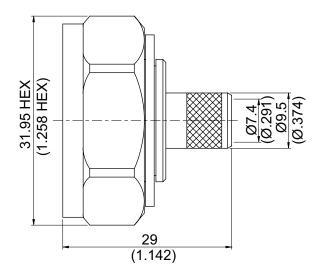

NOTE: Comes with protective dust cap.

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
E-ring	Stainless Steel	Passivated
Gasket	Silicon	
Small Pin	Brass	Silver 100 Over Copper 50
Contact Pin	Phosphor Bronze	Silver 100 Over Copper 50
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Dust Cap	PVC	
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight:

Suitable Cables: JBY400

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## CABLE ASSEMBLY INSTRUCTION JYE BAO CO., LTD. 7/16-3100-L400 **TAIPEI TAIWAN R.O.C** В С D **BODY CONTACT PIN FERRULE** SMALL PIN ASSEMBLY INSTRUCTION **DIAGRAM** 19.2 [.756] Step 1: STRIP AS SHOWN. Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ". В Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "A" IN PLACE. Step 5: SCREW SMALL PIN " D " ON CONTACT PIN " B ". D Step 6: SLIDE FERRULE " C " TOWARDS THE CONNECTOR "A" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.