


MMCX3100-9178

## MMCX Plug Crimp Right Angle $50\Omega$

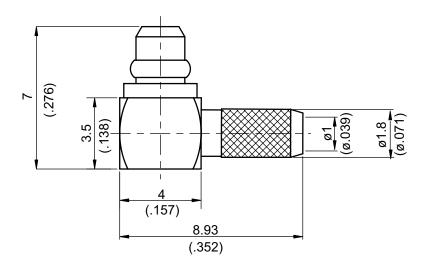

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Cover	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Contact Pin	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Renber Ring	Beryllium Copper	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20
Insulator	Teflon	
Body	Brass	Gold 4 Over Nickel Phosphorous Alloy 80 Over Copper 20

Weight: 0.72 g

Suitable Cables: RG178, RG196, RG178-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## **CABLE ASSEMBLY INSTRUCTION** MMCX3100-9178 JYE BAO CO., LTD. В Κ D Α **FERRULE INSULATOR** COVER BODY \*TOOLS AND FIXTURES ARE REFERENCE ON PAGE 306 OF JYEBAO'S 2005 CATALOG DIAGRAM ASSEMBLY INSTRUCTION 7.5 [.295] Step 1: STRIP AS SHOWN . Step 2: SLIDE FERRULE "B" OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ". Step 5: SLIDE FERRULE "B" TOWARDS THE CONNECTOR " A " AND CRIMP . FORCE Step 6: PRESS ON THE TOP OF "K" "D" WITH JIGS.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.