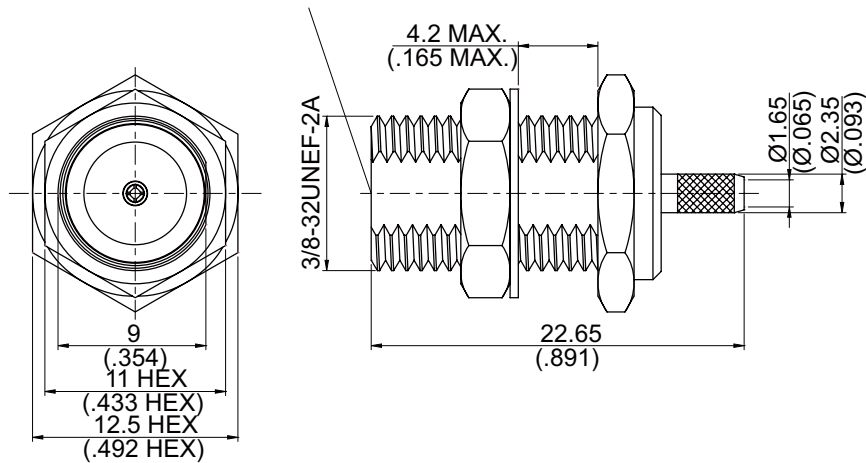


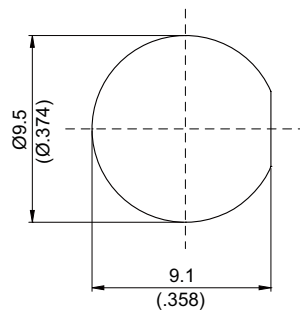
F8100-0179

F Jack Crimp For Bulkhead

75Ω



MOUNTING HOLE:



Parts	Material	Plating (Micro-inch)
Hex Nut	Brass	Nickel 200 Over Copper 50
Lock Washer	Brass	Nickel 200 Over Copper 50
Barrel	Brass	Nickel 200 Over Copper 50
Contact Pin	Phosphor Bronze	Gold 3 over Nickel 50 over Copper 50
Ferrule	Brass	Nickel 200 Over Copper 50
Body	Brass	Nickel 200 Over Copper 50
Insulator	P.P.	

Weight:

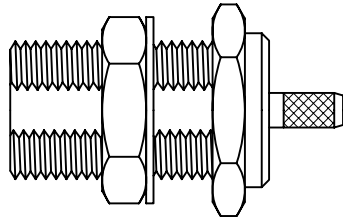
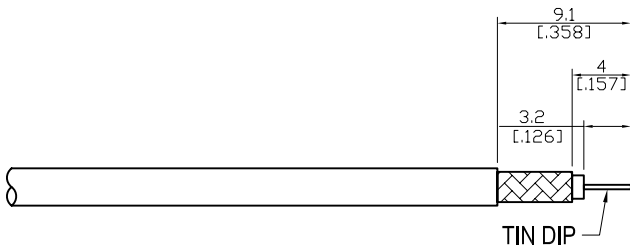
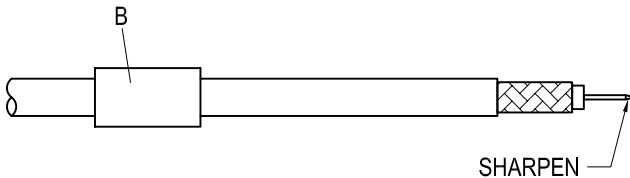
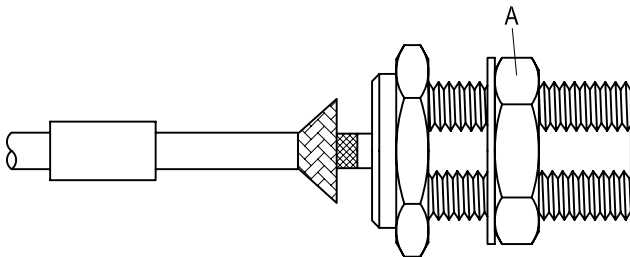
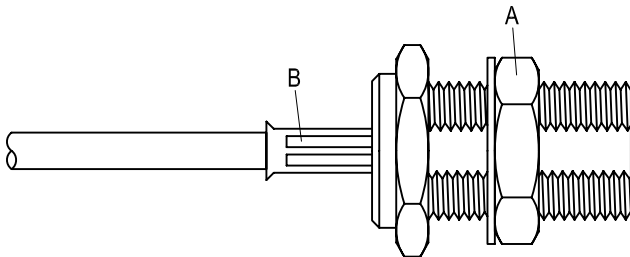
Suitable Cables: RG179, RG179-FEP

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

F8100-0179		DATE	2016/01/20	REV	—
A  BODY		B  FERRULE			
DIAGRAM		ASSEMBLY INSTRUCTION			
		Step 1: STRIP AS SHOWN. Step 2: TIN DIP.			
		Step 3: SHARPEN CENTER CONDUCTOR TIP. Step 4: SLIDE FERRULE " B " OVER CABLE.			
		Step 5: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.			
		Step 6: SLIDE FERRULE " B " TOWARDS THE CONNECTOR " A " AND CRIMP. (USE 3.3mm/0.130inch HEX SECTION OF INSERT-A)			
This part number complies with RoHS. Notice: JYEBAO reserves the right to make modifications deemed appropriate.					
APPROVED		CHECKED		DRAWING	
				Albert	