
SM-Mount

Mobile Mount for Mounting on the Curved Wings

DESCRIPTION

- High-quality mobile mount for mounting on the curved wings.
- M6 internal thread whip-fastening system.
- Supplied with three different packing gaskets for optimum adjustment to the wing.
- Provided with FME-connection system cable to be ordered separately.
- Whips available for communications bands within 66 1000 MHz.

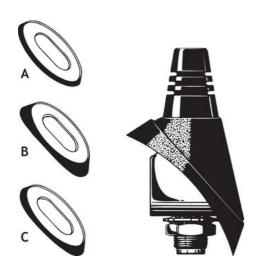

ORDERING DESIGNATIONS

Order this mount by simply asking for the SM (or SM-mount). Cable is to be ordered separately.


SPECIFICATIONS

MODEL	SM-Mount
APPLICATION	Mount for mobile antennas
FREQUENCY	66 - 1000 MHz
CONNECTION TO WHIP	M6 internal thread
MATERIALS	Stainless steel Cu-nite brass Environment-proof plastics
COLOUR	Black
HEIGHT	Approx. 50 mm
INSTALLATION DIAMETER	45 x 55 mm (elliptic)
BUILD-IN DEPTH	Approx. 40 mm
RECOMMENDED INSTALLATION TORQUE	6.5 ± 0.5 Nm
WEIGHT	80 g
MOUNTING	17 x 30 mm oval hole


INSTALLATION

The SM-mount is especially designed for mounting on curved surfaces, e.g. the curved wings. The mount is supplied withthree diffrent packing gaskets to ensure the best possible adjustment to the wing contour at the desired locations of theinstallation. Please refer to the installations steps described below. A good contact surface on the inside of the car body must always be ensured, thus enabling the base plate to get in directcontact with the metal parts of the car, which is of utmost importance for proper performance of the antenna. When cleaning the car in car-washing machines, the whip should be removed. After wash, the whip is refitted and tightened lightly.

1. INSTALLATION DIMENSIONS

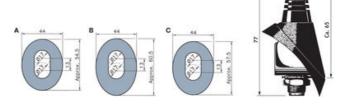

2. INSTALLATION STEPS

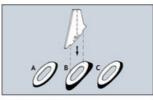


Installation tools.
 To find a possible location for the installation of the SM-mount, the accompanying cardboard model of the mount may be used together with the three packing gaskets (types A, B and C). Which one of the packing gaskets to use depends on the angle and the curving of the wing.



2. Determine a suitable location for the installation. Use the cardboard model of the mount together with a packing gasker to check the fitting to the whall control of the control of the cardboard model can be a suitable control to the desired installation spot. As a indicated by the dotted line on the cardboard model can be obtained for the whip. If not, try another packing gasket or try moving the model to find an acceptable location for the installation. (The packing gasket should be oriented with the letter indicating the gasket type (A, B or C) at the bottom end). Check that there are no obstacles on the inside to prevent installation.



3. Mark the position for the SM-mount. With the cardboard model in the correct position place two marks as indicated on the figure. The distance between the marks is 13 mm and the marks are to be placed as close to the cardboard model as possible. Remove the cardboard model and the packing gasket.

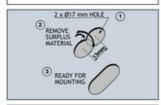

Make the hole for the installation.
The hole for the installation is made by drilling two 17 mm dia. holes with the marks as centres.
The remaining metal between the holes is removed by cutting/nipping.



5. Install the SM-mount.
Install the SM-mount as shown in
the figure. Fine-adjust the positioning
of the whip before tightening the mount
- recommended installation torque: 6.5±0.5 Nm.



Fit the whip.
 Fit the whip and tighten it lightly with a 9 mm fork spanner.



PROCOM A/S reserve the right to amend specifications without prior notice.

16/01/2009



