


N3100AD-9316

N Plug Crimp Right Angle

50Ω

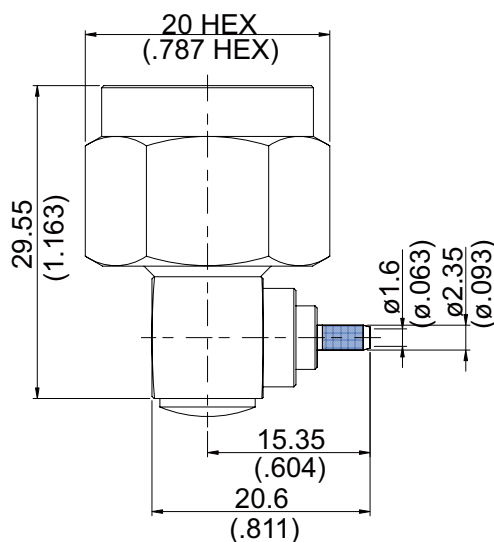

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 5 Over Nickel 50 Over Copper 50
Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

Weight: 34.44 g

Suitable Cables: RD316,RG316D-E,RD316-FEP,

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

N3100AD-9316

JYE BAO CO., LTD.

N3100AD-9316

DATE

2014/04/29


REV

—

A

B

C

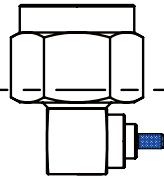

BODY




NUT




FERRULE

DIAGRAM

ASSEMBLY INSTRUCTION

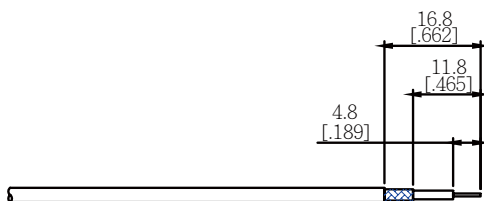


Step 1: STRIP AS SHOWN.

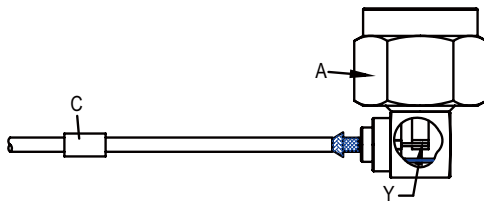

Step 2: SLIDE FERRULE "C" OVER CABLE.


Step 3: WRAP THE BRAIDING UPWARDS.

Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "A" AND SOLDER IN "Y".

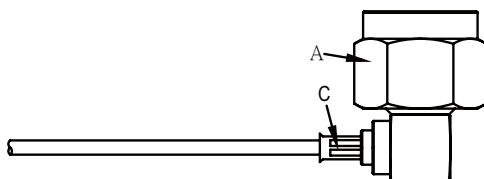

Step 5: SLIDE FERRULE "C" TOWARDS THE CONNECTOR "A" AND CRIMP.

(USE 3.3mm/0.130inch SECTION OF INSERT-A)

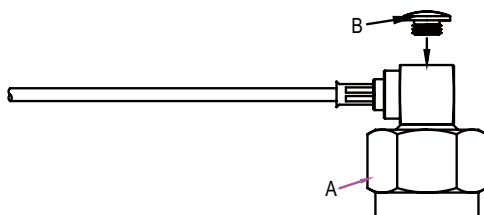

Step 6: SCREWNUT "B" ON THE CONNECTOR "A".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.