


SMA6100-L200

SMA Reverse Polarity Plug Crimp 50Ω

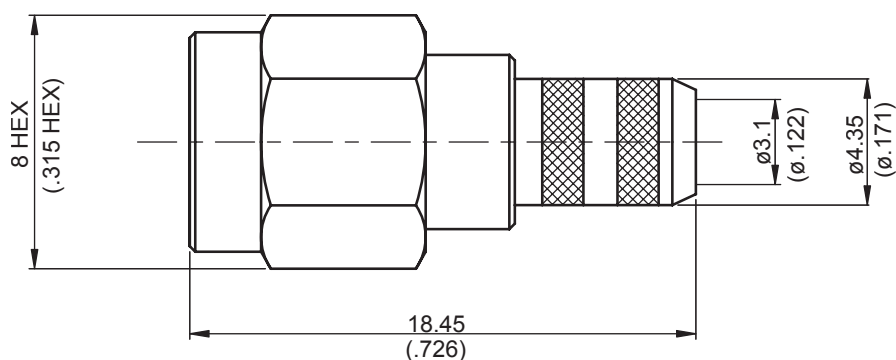

Parts	Material	Plating(Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Insulator	Teflon	
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 4.24 g

Suitable Cables: JBY200

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION


SMA6100-L200

JYE BAO CO., LTD.
TAIPEI TAIWAN R.O.C

A

B

C




FERRULE

CONTACT PIN


BODY

DIAGRAM


ASSEMBLY INSTRUCTION

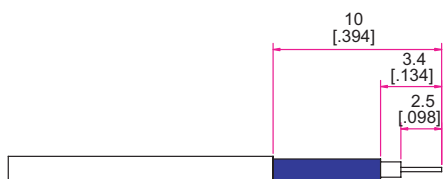


Step 1: STRIP AS SHOWN.

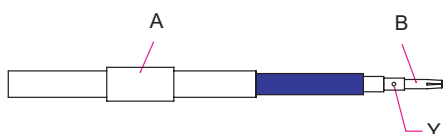

Step 2: SLIDE FERRULE "A" OVER CABLE.
Step 3: PUT PIN "B" ON CENTER CONDUCTOR
AND SOLDER IN "Y".

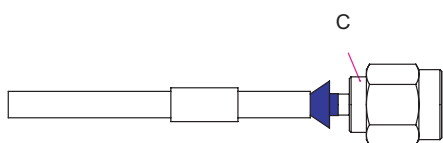

Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR
"C" IN PLACE.

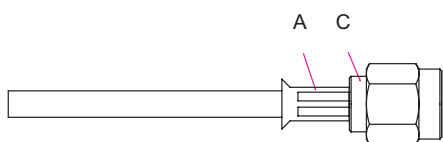

Step 5: SLIDE FERRULE "A" TOWARDS THE
CONNECTOR "C" AND CRIMP.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.