


SMA6100-9058

SMA Reverse Polarity Plug Crimp Right Angle 50Ω

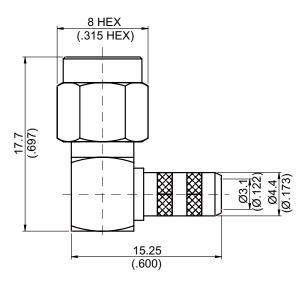

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Cover	Brass	Gold 20 Over Nickel 50 Over Copper 50
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight:

Suitable Cables: RG58, JBY195

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



CABLE ASSEMBLY INSTRUCTION SMA6100-9058 JYE BAO CO., LTD. С Α В **BODY COVER FERRULE DIAGRAM** ASSEMBLY INSTRUCTION Step 1: STRIP AS SHOWN. 5 [.197] Step 2: SLIDE FERRULE " C " OVER CABLE . Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN "Y" Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR "A"AND CRIMP . **FORCE** Step 6: PRESS ON THE TOP OF " $\ensuremath{\mathsf{B}}$ " WITH $\ensuremath{\mathsf{JIGS}}$. JIG

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.