


SMA6100-9316

**SMA Reverse Polarity Plug Crimp Right Angle** 

50Ω

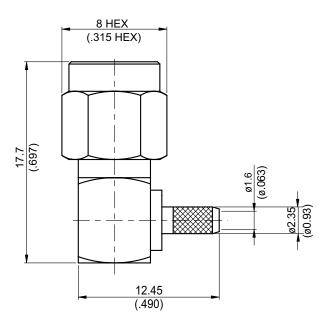

	1	
Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Cover	Brass	Gold 5 Over Nickel 50 Over Copper 50
Renbrock Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicon	
Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Barrel	Brass	Gold 5 Over Nickel 50 Over Copper 50
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 4.56 g

Suitable Cables: RG174, RG188, RG316, RG316-FEP, RG316-E

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.



## CABLE ASSEMBLY INSTRUCTION SMA6100-9316 JYE BAO CO., LTD. Α В С **FERRULE** COVER **BODY** ASSEMBLY INSTRUCTION DIAGRAM Step 1: STRIP AS SHOWN. 3.3 [.130] Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: WRAP THE BRAIDING UPWARDS. Step 4: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR "B", AND SOLDER IN "Y". Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "B" AND CRIMP. FORCE Step 6: PRESS ON THE TOP OF "C" WITH JIGS.

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.