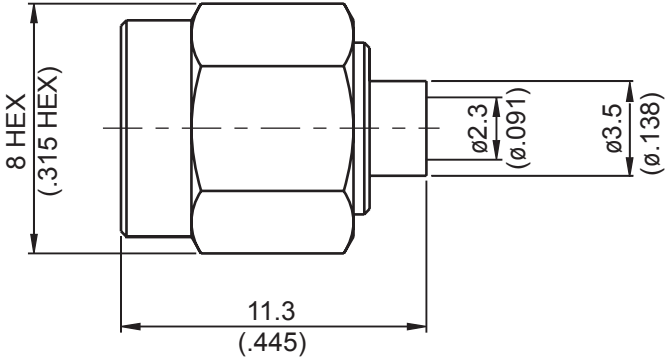


SMA3300-0085	SMA Plug Solder	50Ω																					
 Technical drawing of the SMA Plug Solder showing dimensions in inches and millimeters. The drawing includes a side view and a top view. The side view shows a hexagonal body with a length of 11.3 inches (.445 inches) and a hexagonal head with a height of 8 inches (.315 inches). The top view shows a circular base with a diameter of 2.3 inches (ø.091 inches) and a central pin with a diameter of 3.5 inches (ø.138 inches).																							
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Contact Pin</td><td>Brass</td><td>Gold 20 Over Nickel 50 Over Copper 50</td></tr> <tr> <td>Renber Ring</td><td>Beryllium Copper</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Gasket</td><td>Silicon</td><td></td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Body</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr> <tr> <td>Coupling Nut</td><td>Brass</td><td>Gold 5 Over Nickel 50 Over Copper 50</td></tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50	Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Insulator	Teflon		Body	Brass	Gold 5 Over Nickel 50 Over Copper 50	Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50
Parts	Material	Plating (Micro-inch)																					
Contact Pin	Brass	Gold 20 Over Nickel 50 Over Copper 50																					
Renber Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50																					
Gasket	Silicon																						
Insulator	Teflon																						
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50																					
Coupling Nut	Brass	Gold 5 Over Nickel 50 Over Copper 50																					
Weight: 2.42 g Suitable Cables: Semi-rigid.085																							

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

CABLE ASSEMBLY INSTRUCTION

SMA3300-0085

JYE BAO CO., LTD.

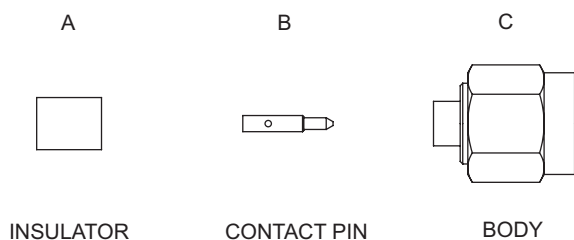


DIAGRAM	ASSEMBLY INSTRUCTION
	Step 1: STRIP AS SHOWN.
	Step 2: INSERT CABLE'S CENTER CONDUCTOR INTO CENTER PIN AND SOLDER IN "Y", USE 0.3 MM GAGE.
	Step3: PUT CABLE INTO SOLDERING FIXTURE "ST-008". AND LOCK IT. PUT CONNECTOR AS SHOWN. Step4: SCREW LOCATOR TOOL "ST-011" TO THE POSITION AS SHOWN IN "S", AND SOLDER IN "X".
	Step5: USE DIELECTRIC INSERTION TOOL "ST-003" TO INSERT THE TEFLON "A".

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.