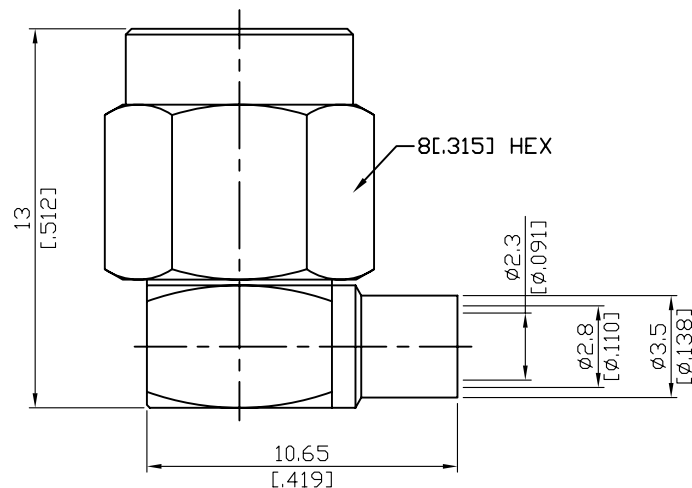


SMA3300C-9405/W

SMA Plug Solder Right Angle
For 5002; SS405

50Ω



Parts	Material	Plating (Micro-inch)
Cover	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Contact Pin	Brass	Gold 4 Over Nickel-Phosphorus Alloy 80 Over Copper 20
Retainer Ring	Beryllium Copper	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Gasket	Silicone	
Insulator	Teflon	
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50

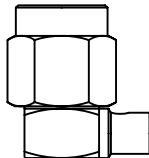


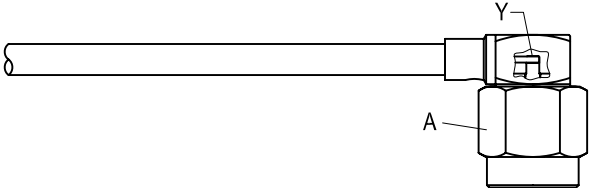
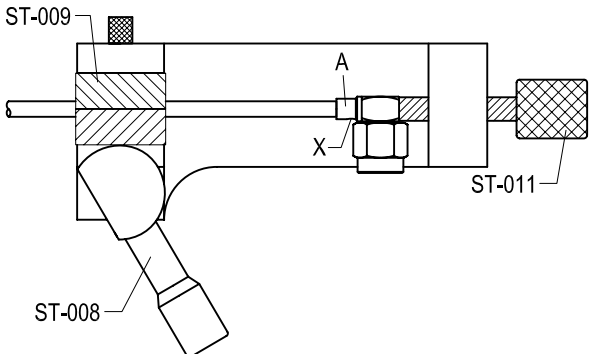
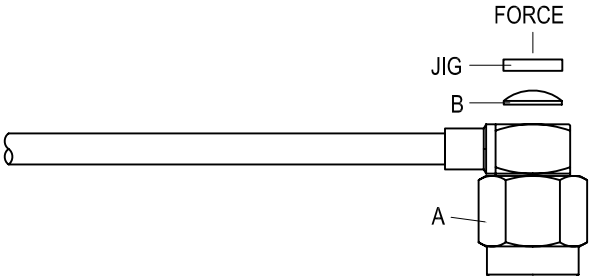
Suitable Cables: SS405, 5002, 5002LD, T-Flex405, Multibend 405

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications demand appropriate.

JYE BAO CO., LTD.

CABLE ASSEMBLY INSTRUCTION

SMA3300C-9405/W		DATE	2017/07/03	REV	—
<div><div><div>A</div><div></div><div>BODY</div></div><div><div>B</div><div></div><div>COVER</div></div></div>					
DIAGRAM			ASSEMBLY INSTRUCTION		
			Step 1: STRIP AS SHOWN.		
			Step 2: SLIDE CENTER CONDUCTOR ON THE CONTACT PIN OF CONNECTOR " A " AND SOLDER IN " Y ".		
			Step 3: USE SOLDERING FIXTURE " ST-008 ", INSERT TOOL " ST-009 " AND LOCATOR TOOL " ST-011 " TO FIX THE CONNECTOR. SOLDER IN " X ".		
			Step 4: PRESS ON THE TOP OF " C " WITH JIGS.		
<div>This part number complies with RoHS.</div> <div>Notice: JYEBAO reserves the right to make modifications deemed appropriate.</div>					
APPROVED		CHECKED		DRAWING	
				