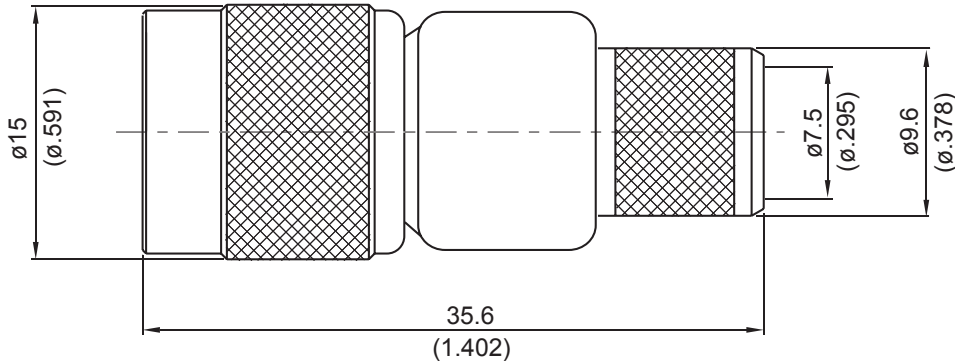


TNC3100-0213	TNC Plug Crimp	50Ω																											
																													
<table border="1"> <thead> <tr> <th>Parts</th><th>Material</th><th>Plating (Micro-inch)</th></tr> </thead> <tbody> <tr> <td>Ferrule</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Center Pin</td><td>Brass</td><td>Gold 3 Over Nickel 50 Over Copper 50</td></tr> <tr> <td>Retainer Ring</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Gasket</td><td>Silicon</td><td></td></tr> <tr> <td>Barrel</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Insulator</td><td>Teflon</td><td></td></tr> <tr> <td>Body</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> <tr> <td>Coupling Nut</td><td>Brass</td><td>Tin-Zinc-Copper-Alloy 100 Over Copper 50</td></tr> </tbody> </table>			Parts	Material	Plating (Micro-inch)	Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Center Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50	Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Gasket	Silicon		Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Insulator	Teflon		Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50	Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50
Parts	Material	Plating (Micro-inch)																											
Ferrule	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Center Pin	Brass	Gold 3 Over Nickel 50 Over Copper 50																											
Retainer Ring	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Gasket	Silicon																												
Barrel	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Insulator	Teflon																												
Body	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Coupling Nut	Brass	Tin-Zinc-Copper-Alloy 100 Over Copper 50																											
Weight: Suitable Cables: RG213 ,RG8																													

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.

## CABLE ASSEMBLY INSTRUCTION

TNC3100-0213

JYE BAO CO., LTD.

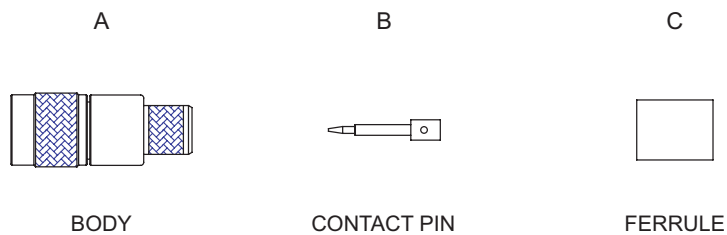


DIAGRAM	ASSEMBLY INSTRUCTION
	<p>Step 1: STRIP AS SHOWN .</p>
	<p>Step 2: SLIDE FERRULE " C " OVER CABLE. Step 3: PUT PIN " B " ON CENTER CONDUCTOR AND SOLDER IN " Y ".</p>
	<p>Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR " A " IN PLACE.</p>
	<p>Step 5: SLIDE FERRULE " C " TOWARDS THE CONNECTOR " A " AND CRIMP.</p>

This part number complies with RoHS.

Notice: JYEBAO reserves the right to make modifications deemed appropriate.